



[4910-13-P]

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2018-0326; Product Identifier 2018-CE-006-AD; Amendment 39-19464; AD 2018-21-06]

RIN 2120-AA64

Airworthiness Directives; SOCATA Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Final rule.

SUMMARY: We are superseding Airworthiness Directive (AD) 98-16-03 for SOCATA Model TB 9 and Model TB 10 airplanes. This AD results from mandatory continuing airworthiness information (MCAI) issued by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as fatigue cracking of the wing front attachments on the wing and fuselage sides. We are issuing this AD to require actions to address the unsafe condition on these products.

DATES: This AD is effective [INSERT DATE 35 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in the AD as of [INSERT DATE 35 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

ADDRESSES: You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0326; or in person at Docket Operations, U.S. Department of Transportation, Docket

Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

For service information identified in this AD, contact SOCATA, Direction des services, 65921 Tarbes Cedex 9, France; phone: +33 (0) 5 62 41 73 00; fax: +33 (0) 5 62 41 76 54; email: info@socata.daher.com; Internet:

<https://www.mysocata.com/login/accueil.php>. You may view this referenced service information at the FAA, Policy and Innovation Division, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148. It is also available on the Internet at <http://www.regulations.gov> by searching for Docket No. FAA-2018-0326.

FOR FURTHER INFORMATION CONTACT: Quentin Coon, Aerospace Engineer, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4168; fax: (816) 329-4090; email: quentin.coon@faa.gov.

SUPPLEMENTARY INFORMATION:

Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to supersede AD 98-16-03, Amendment 39-10677 (63 FR 40359, July 29, 1998) ("AD 98-16-03"). The NPRM was published in the *Federal Register* on May 9, 2018 (83 FR 21199), and proposed to correct an unsafe condition for SOCATA Model TB 9, Model TB 10, and Model TB 200 airplanes. We based the NPRM on MCAI originated by an aviation authority of another country. The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, issued EASA AD No. 2018-0030, dated January 31, 2018 (referred to after this as "the MCAI"). The MCAI states that:

During a scheduled maintenance inspection, cracks were found on the wing front attachments of a TB 10 aeroplane.

This condition, if not detected and corrected, could affect the structural integrity of the aeroplane.

Prompted by these findings, SOCATA issued SB 10-081-57 to provide inspection and modification instructions, and DGAC France issued AD 94-264(A), later revised, to require repetitive inspections of wing front attachments of TB 9 and TB 10 aeroplanes (all MSN up to 822 inclusive, with some excluded). That [DGAC France] AD also required installation of reinforcement kits, applied as repair (if cracks were found) or as modification (if no cracks were found), of the wing front attachments, on both wing and fuselage sides, and repetitive replacement of those reinforcements afterwards.

Since DGAC France AD 94-264(A) R1 was issued, cracks have been found on wing front attachments, on the wing side, on TB10 aeroplanes to which the AD did not apply, i.e. which were not subject to repetitive inspections as required by that [DGAC France] AD. Consequently, SOCATA revised SB 10-081-57 (now at revision (rev) 3), extending the Applicability to all TB 10 aeroplanes, as well as to TB 200 aeroplanes, and improving the repair solution of the wing front attachment on wing side.

For the reason described above, this [EASA] AD retains the requirements of DGAC France AD 94-264(A) R1, which is superseded, expands the Applicability to all MSN for TB 9 and TB 10 aeroplanes and includes TB 200 aeroplanes, and requires an improved repair solution of the wing front attachment on wing side.

The MCAI can be found in the AD docket on the Internet at:

<https://www.regulations.gov/document?D=FAA-2018-0326-0003>.

Comments

We gave the public the opportunity to participate in developing this AD. The following presents the comment received on the proposal and the FAA's response to the comment.

Request for an Explanation of Compliance Time

Daher requested that we explain why the compliance times in the NPRM are presented in landings and do not match the compliance times in the EASA AD, which uses both hours time-in-service (TIS) and number of landings.

The NPRM retained the compliance times from AD 98-16-03, which were based in landings instead of hours TIS. The NPRM also retained the formula for converting hours TIS to landings from AD 98-16-03 for airplanes with an unknown number of landings. Because we also retained the effective date of AD 98-16-03 for certain actions, we determined the NPRM would not use both landings and hours TIS, as in the EASA AD.

Change to the Final Rule

In the NPRM, in table 1 to paragraph (g)(1) and table 4 to paragraph (i)(1), we inadvertently referenced the incorrect paragraph designator in the retained compliance times as, "See paragraph (g) of this AD." In this AD, we corrected the paragraph designator to read, "See paragraph (k) of this AD."

We also revised the incorporation by reference of the service information to specify the provisions required for each action, instead of the entire service document.

Conclusion

We reviewed the relevant data, considered the comment received, and determined that air safety and the public interest require adopting the AD as proposed except for the changes previously described and other minor editorial changes. We have determined that these changes:

- Are consistent with the intent that was proposed in the NPRM for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

Related Service Information under 1 CFR part 51

We reviewed Daher Service Bulletin SB 10-081, Revision 3, dated December 2017. The service bulletin describes procedures for inspecting the front attachments and installing modification kits. This service information is reasonably available because the

interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

Costs of Compliance

We estimate that this AD will affect 126 products of U.S. registry. We also estimate that it would take about 3 work-hours per product to comply with the inspection requirements of this AD. We also estimate that it would take about 25 work-hours per product to comply with the replacement/modification (wing and fuselage sides) requirements of this AD. The average labor rate is \$85 per work-hour. Required parts would cost about \$3,000 per product.

Based on these figures, we estimate the cost of this AD on U.S. operators to be \$677,880, or \$5,380 per product.

In addition, we estimate that any necessary follow-on actions to replace the wing attachment on the wing side, resulting from the repetitive inspections, would take about 9 work-hours and require parts costing \$3,000, for a cost of \$3,765 per product. We have no way of determining the number of products that may need these actions.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to small airplanes, gliders, balloons, airships, domestic business jet transport airplanes, and associated appliances to the Director of the Policy and Innovation Division.

Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0326; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains the NPRM, the regulatory evaluation, any comments received, and other information. The street address for Docket Operations (telephone (800) 647-5527) is in the ADDRESSES section. Comments will be available in the AD docket shortly after receipt.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39 - AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by removing Airworthiness Directive (AD) 98-16-03, Amendment 39-10677 (63 FR 40359, July 29, 1998) and adding the following new AD:

2018-21-06 **SOCATA**: Amendment 39-19464; Docket No. FAA-2018-0326; Product Identifier 2018-CE-006-AD.

(a) Effective Date

This AD becomes effective [INSERT DATE 35 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

(b) Affected ADs

This AD replaces AD 98-16-03, Amendment 39-10677 (63 FR 40359, July 29, 1998) ("AD 98-16-03").

(c) Applicability

This AD applies to SOCATA airplanes listed in the following groups, certificated in any category:

(1) Group 1 airplanes: Model TB 9, all manufacturer serial numbers (MSN); and Model TB 10, MSN 001 through 803, 805, 806, 809 through 815, and 820 through 822; and

(2) Group 2 airplanes: Model TB 10, MSN 804, 807, 808, 816 through 819, and 823 through 2229; and Model TB 200, all MSNs.

(d) Subject

Air Transport Association of America (ATA) Code 57: Wings.

(e) Reason

This AD was prompted by mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as fatigue cracking of the wing front attachments on the wing and fuselage sides. We are issuing this AD to prevent fatigue cracking of the wing front attachments, which could lead to structural failure of the airplane and loss of control.

(f) Compliance

Unless already done, do the following actions listed in paragraphs (g) through (j) of this AD. The compliance times of this AD are presented in landings instead of hours time-in-service (TIS). If the number of landings is unknown, multiply the number of hours TIS by 1.5. For the purposes of this AD, the "XX" in the kit numbers can be any numerical value.

(g) Actions for Airplanes NOT EQUIPPED with Modification Kit OPT109110XX

(1) Within the compliance time specified in table 1 to paragraph (g)(1) of this AD, do an initial inspection of the wing front attachments on the wing side. Inspect repetitively thereafter at intervals not to exceed 3,000 landings. Follow paragraphs B(1) through B(4) under the Description of Accomplishment Instructions in SOCATA Daher Service Bulletin SB 10-081, Revision 3, December 2017 (SB 10-081, Revision 3).

Table 1 to paragraph (g)(1) of this AD—Front Wing Attachment, Wing Side, Initial Inspection

Compliance Time for Initial Inspection of the Front Wing Attachment, Wing Side (whichever occurs later, A or B)	
A	Before or upon accumulating 3,000 landings on the airplane; or
B	Group 1 airplanes: Within the next 100 landings after September 21, 1998 (the effective date retained from AD 98-16-03). See paragraph (k) of this AD.
	Group 2 airplanes: Within 13 months after the effective date of this AD.

(2) If a crack was found during any inspection required in paragraph (g)(1) of this AD, before further flight, install the modification reinforcement kit OPT10911002 for the front attachment on the wing side. Follow paragraph B(5) under the Description of Accomplishment Instructions in SB 10-081, Revision 3.

(3) Within the compliance time specified in table 2 to paragraph (g)(3) of this AD, unless already done as corrective action as specified in paragraph (g)(2) of this AD, install the modification reinforcement kit OPT10911002 for the front attachment on the wing side. Follow paragraph B(5) under the Description of Accomplishment Instructions in SB 10-081, Revision 3.

Table 2 to paragraph (g)(3) of this AD—Front Wing Attachment, Wing Side, Installation of the Reinforcement Modification Kit

Compliance Time for Installation of the Reinforcement Modification Kit (whichever occurs later, A or B)	
A	Before or upon accumulating 12,000 landings on the airplane; or
B	Within the next 75 landings after the effective date of this AD.

(h) Actions for Airplanes EQUIPPED with Modification Kit OPT109110XX

(1) Within the compliance time specified in table 3 to paragraph (h)(1) of this AD, do an initial inspection of the reinforced front attachment on the wing side. Inspect repetitively thereafter at intervals not to exceed 3,000 landings. Follow paragraphs B(1)

through B(4) under the Description of Accomplishment Instructions in SB 10-081, Revision 3.

Table 3 to paragraph (h)(1) of this AD—Front Wing Attachment, Wing Side, Reinforcement Kit Initial Inspection

Compliance Time for Initial Inspection of the Reinforcement Kit (whichever occurs later, A or B)	
A	Before or upon accumulating 6,000 landings on the airplane after installation of the reinforcement modification kit OPT109110XX; or
B	Within the next 75 landings after the effective date of this AD.

(2) Replacing kit OPT109110XX with kit OPT10911002 on an airplane, at intervals not to exceed 6,000 landings, is acceptable to comply with the inspection requirements of paragraph (h)(1) of this AD for that airplane. Follow paragraph B(5) under the Description of Accomplishment Instructions in SB 10-081, Revision 3.

(3) If a crack was found during any inspection required in paragraph (h)(1) of this AD, before further flight, do the applicable corrective actions. Follow paragraph B(5) under the Description of Accomplishment Instructions in SB 10-081, Revision 3.

(i) Actions for Group 1 Airplanes

(1) Within the compliance time specified in table 4 to paragraph (i)(1) of this AD, do an initial inspection of the wing front attachments on the fuselage side. Inspect repetitively thereafter at intervals not to exceed 3,000 landings. Follow paragraphs B(1) through B(4) under the Description of Accomplishment Instructions in SB 10-081, Revision 3.

Table 4 to paragraph (i)(1) of this AD—Front Wing Attachment, Fuselage Side, Initial Inspection

Compliance Time for Initial Inspection of the Front Wing Attachment, Fuselage Side (whichever occurs later, A or B)	
A	Before or upon accumulating 3,000 landings on the airplane; or
B	Within the next 100 landings after September 21, 1998 (the effective date of this AD retained from AD 98-16-03). See paragraph (k) of this AD.

(2) If a crack was found during any inspection required in paragraph (i)(1) of this AD, before further flight, do the applicable corrective actions. Follow paragraph B(5) under the Description of Accomplishment Instructions in SB 10-081, Revision 3.

(3) Unless already done as corrective action required in paragraph (i)(2) of this AD, within the compliance time specified in table 5 to paragraph (i)(3) of this AD, reinforce the front attachment on fuselage side. Follow paragraph B(5)(b) under the Description of Accomplishment Instructions in SB 10-081, Revision 3.

Table 5 to paragraph (i)(3) of this AD—Front Wing Attachment, Fuselage Side, Reinforcement Modification

Airplane Models	MSN and Configuration	Compliance Time
TB 9 TB 10	MSN 001 to 399 and 413 airplanes that do not have SOCATA Technical Instruction OPT10-9081-53 (Kit OPT908100) installed	Before or upon accumulating 6,000 landings on the airplane.
	MSN 001 to 399 and 413 airplanes that do have SOCATA Technical Instruction OPT 10-9081-53 (Kit OPT908100) installed	Before or upon accumulating 12,000 landings on the airplane.
TB 9	MSN 400 to 412 and 414 to 2229	
TB 10	MSN 400 to 412, 414 to 803, 805, 806, 809 to 815, and 820 to 822	

(4) Before or upon accumulating 12,000 landings after the reinforcement modification required in paragraph (i)(2) or (3) of this AD, replace the reinforced front attachment on the fuselage side. Follow paragraph B(5)(c) under the Description of Accomplishment Instructions in SB 10-081, Revision 3.

(j) Replacement of the Reinforced Front Attachment

Replacement of the reinforced front attachment on the wing side and/or replacement of the reinforced front attachment on the fuselage side does not terminate the inspections required in paragraphs (h)(1) and (i)(1) of this AD. After replacement, the initial and repetitive inspection cycle starts over.

(k) Credit for Previous Actions

This AD allows credit for the initial inspections required in paragraphs (g)(1), (h)(1), and (i)(1) of this AD if done before the effective date of this AD by following Socata Service Bulletin No. SB 10-081-57, Revision 1, dated August 1996 or Revision 2, dated January 2017. This AD also allows credit for any replacement that may have been required based on the initial inspection required in paragraphs (g)(1), (h)(1), and (i)(1) of this AD if done before the effective date of this AD by following Socata Service Bulletin No. SB 10-081-57, Revision 1, dated August 1996 or Revision 2, dated January 2017. After the effective date of this AD, you must do any inspections or replacements by following SB 10-081, Revision 3.

(l) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Small Airplane Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Quentin Coon, Aerospace Engineer, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4168; fax: (816) 329-4090; email: quentin.coon@faa.gov. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must instead be accomplished using a method approved by the Manager, Small Airplane Standards Branch, FAA; or the European Aviation Safety Agency (EASA).

(m) Related Information

Refer to MCAI EASA No. 2018-0030, dated January 31, 2018; and Socata Service Bulletin No. SB 10-081-57, Revision 1, dated August 1996, or Revision 2, dated January 2017, for related information. The MCAI can be found in the AD docket on the Internet at: <https://www.regulations.gov/document?D=FAA-2018-0326-0003>.

(l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) SOCATA Daher Service Bulletin SB 10-081, Revision 3, December 2017.

(ii) [Reserved]

(3) For service information identified in this AD, contact SOCATA, Direction des services, 65921 Tarbes Cedex 9, France; phone: +33 (0) 5 62 41 73 00; fax: +33 (0) 5 62 41 76 54; email: info@socata.daher.com; Internet: <https://www.mysocata.com/login/accueil.php>.

(4) You may view this service information at FAA, Policy and Innovation Division, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call 816-329-4148. In addition, you can access this service information on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0326.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to:

<http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Kansas City, Missouri, on October 26, 2018.

Melvin J. Johnson
Aircraft Certification Service
Deputy Director, Policy and Innovation Division, AIR-601

[FR Doc. 2018-24007 Filed: 11/2/2018 8:45 am; Publication Date: 11/5/2018]